

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		 Sheet No: 01
	Job No: 085788	Made by: JTS Chkd by: PT	

Figure 01 - existing buildings to remain up to chimney interface. Hipped roofs



Figure 02 - existing buildings to remain up to chimney interface. Hipped roofs



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 02

Figure 03 - existing buildings to remain



Figure 04 - existing buildings to remain



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		 Sheet No: 03
	Job No: 085788	Made by: JTS Chkd by: PT	

Figure 05 - existing buildings to remain



Figure 06 - existing buildings to remain, DAMAGED LINTELS




Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 04

Figure 07 - existing buildings to remain, VERTICAL CRACKING TO MASONRY WALL. THROUGH BRICK AND JOINT



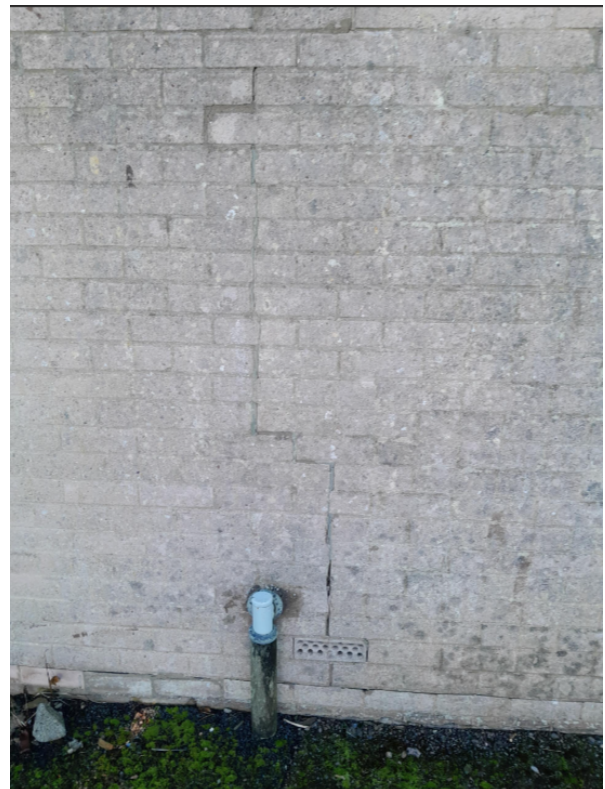Figure 08 - existing buildings to remain, VERTICAL CRACKING TO MASONRY WALL. THROUGH BRICK AND JOINT



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 05

Figure 09 - existing buildings to remain, UNDERSIDE OF UNPROTECTED STEELWORK

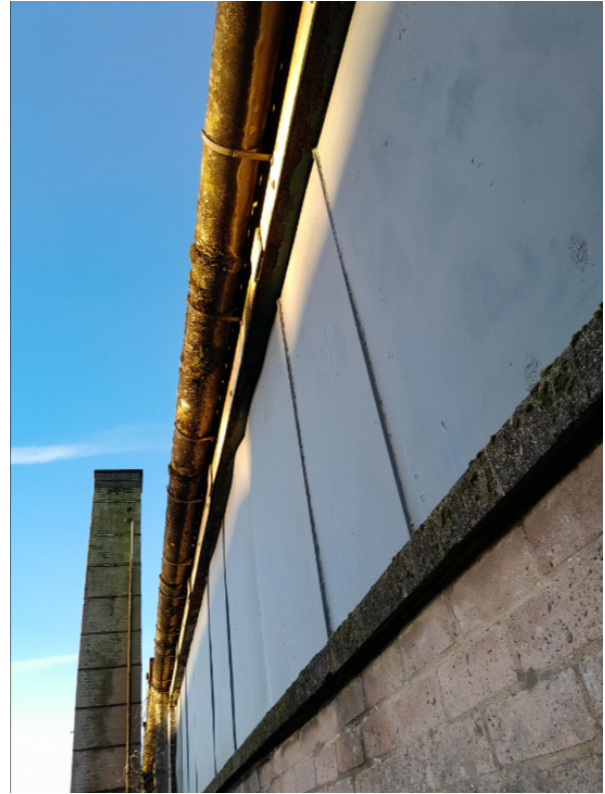


Figure 10 - existing buildings to remain



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		 Sheet No: 06
	Job No: 085788	Made by: JTS Chkd by: PT	

Figure 11 - existing buildings to remain, MASONRY COLOUR CHANGE



Figure 12 - existing CHIMNEY to remain



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 07

Figure 13 - existing buildings **to be demolished**, ASYMMETRIC ROOFFigure 14 - existing buildings **to be demolished**, ASYMMETRIC ROOF

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 08

Figure 15 - pavement and perimeter wall to tank zone. **Council to confirm if demolition is required.**



Figure 16 - pavement and perimeter wall to tank zone. **Council to confirm if demolition is required.**



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 09

Figure 17 - interface between proposed demolition and potential existing tank zone. **Council to confirm.**



Figure 18 - existing buildings **to be demolished**, SINGLE STOREY ENTRANCE



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 10

Figure 19 - existing buildings **to be demolished**, ASYMMETRIC ROOFFigure 20 - existing buildings **to be demolished**, ASYMMETRIC ROOF

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 11


Figure 21 - existing buildings **to be demolished**, CORRODED GUTTER CLEATS JACKING MASONRY

Figure 22 - existing buildings VIEW OF INTERNAL SPINE WALL which is to remain taken from retained side



Curtins Consulting Ltd	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH		Sheet No: 12	

Figure 23 - existing buildings VIEW OF INTERNAL SPINE WALL which is to remain taken from retained side

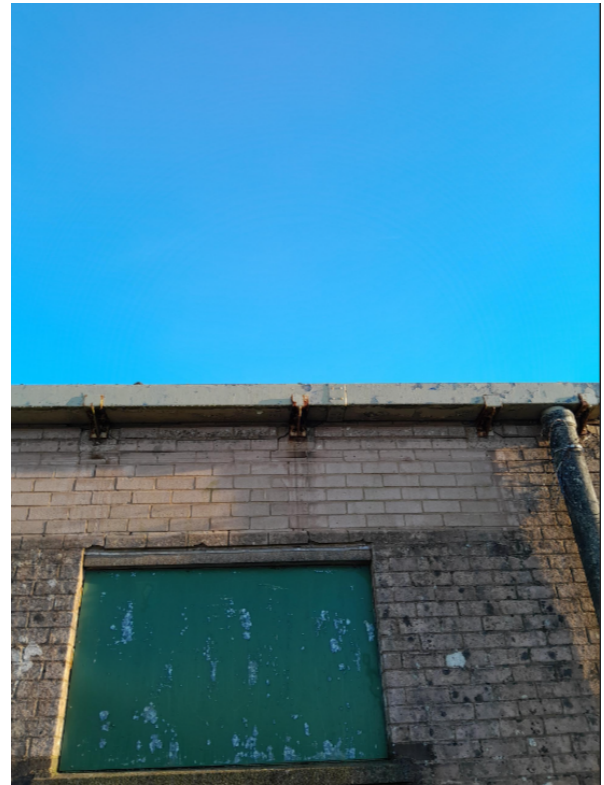

Figure 24 - existing buildings internal outrigger to remain, taken from retained side



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		 Sheet No: 13
	Job No: 085788	Made by: JTS Chkd by: PT	

Figure 25 - view of hipped steelwork and truss system within retained outrigger roof. INT. SPINE WALL BEARS TRUSS

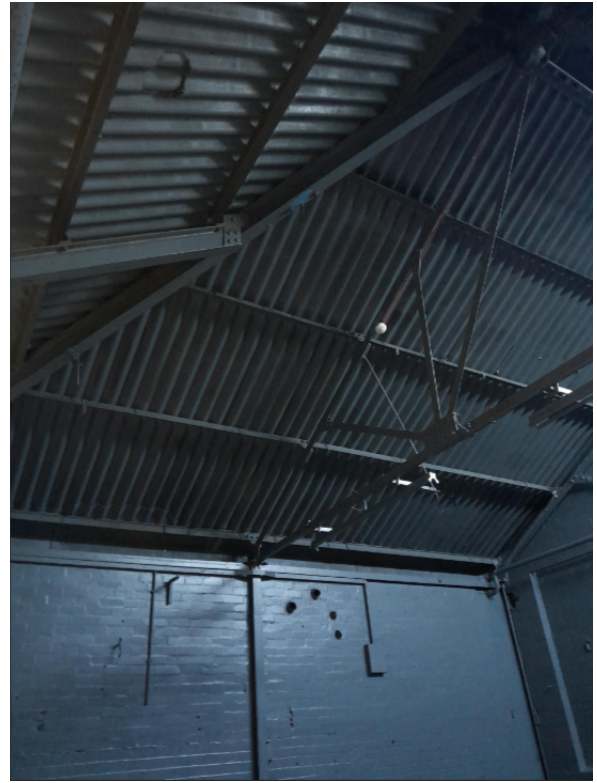


Figure 26 - existing buildings VIEW OF INTERNAL SPINE WALL which is to remain taken from retained side



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 14

Figure 27 - existing buildings VIEW OF INTERNAL SPINE WALL which is to remain taken from retained side



Figure 28 - existing buildings VIEW OF HALF-HEIGHT MASONRY WALL taken from retained side



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 15

Figure 29 - existing buildings **to be demolished**, APPEARS AS CONCRETE SOFFIT to single storey. LB Masonry

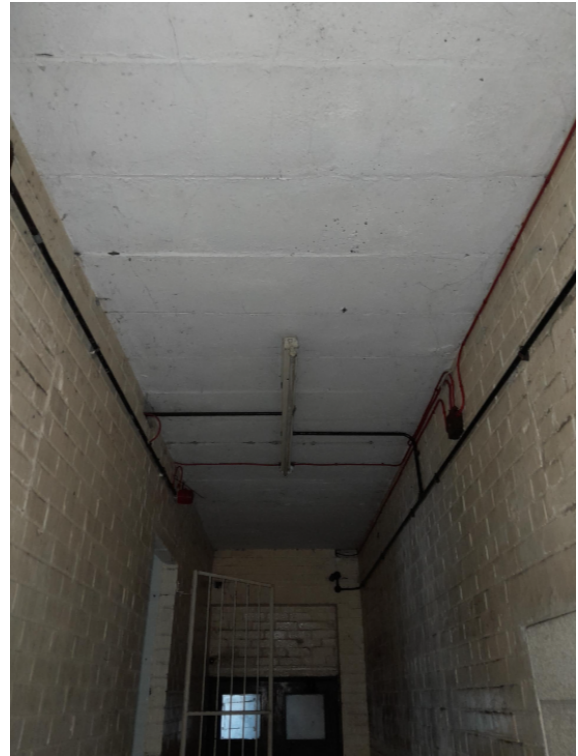


Figure 30 - existing buildings **to be demolished**, APPEARS AS CONCRETE SOFFIT to single storey. LB Masonry



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 16

Figure 31 - internal spine wall and truss column (LEFT) to remain, **perpendicular wall to be demolished**



Figure 32 - existing buildings VIEW OF INTERNAL SPINE WALL which is to remain taken from retained side



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 17

Figure 33 - existing buildings **to be demolished**, single storey workshop. LB Masonry

Figure 34 - existing buildings VIEW OF INTERNAL SPINE WALL which is to remain taken from retained side



INTERNAL SPINE WALL spans full height to valley gutter for the last three bays closest to NW elevation

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 18

Figure 35 - existing buildings **to be demolished**, single storey workshop. DOWNSTAND STEEL (A)Figure 36 - existing buildings **to be demolished**, DOWNSTAND STEEL (A) CONNECTING INTO TRUSS COLUMN

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 19

Figure 37 - existing buildings **to be demolished**, ROOF BRACINGFigure 38 - existing buildings **to be demolished**, ROOF BRACING

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 20

Figure 39 - BACK WALL REMAINING



Figure 40 - BACK WALL REMAINING perpendicular wall to be demolished



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 21

Figure 41 - internal spine wall and truss column (LEFT) to remain, **perpendicular wall to be demolished**Figure 42 - existing buildings **to be demolished**, DOOR THRESHOLD

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 22

Figure 43 - existing buildings **to be demolished**, FLAT ROOF TRUSS, for open floor zoneFigure 44 - existing buildings **to be demolished**, FLAT ROOF TRUSS adjacent to glazing

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 23

Figure 45 - existing buildings **to be demolished**, HOT-ROLLED PURLINFigure 46 - existing buildings **to be demolished**, TWO-BRICK THICK MASONRY WALL

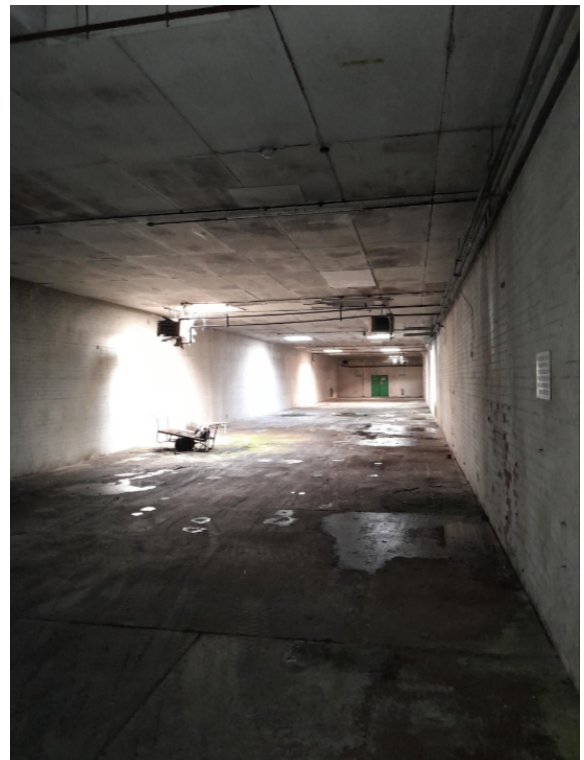
Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 24

Figure 47 - existing buildings **to be demolished**, INTERNAL ROOF TRUSSFigure 48 - existing buildings **to be demolished**, INTERNAL ROOF TRUSS, LGS free standing structure

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 25

Figure 49 - existing buildings **to be demolished**, INTERNAL ROOF TRUSS, ROOF BRACINGFigure 50 - existing buildings **to be demolished**, INTERNAL ROOF TRUSS, HALF HEIGHT MASONRY WALL

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 26

Figure 51 - existing buildings **to be demolished**, SCREWED ON SOFFIT, CONCRETE LINTELFigure 52 - existing buildings **to be demolished**, view of zone 3

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 27

Figure 53 - existing buildings **to be demolished**, zone 3 internal view of ACCESS DOORFigure 54 - existing buildings **to be demolished**, zone 3 ROOFLIGHT, SOFFIT

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 28

Figure 55 - existing buildings **to be demolished**, FLAT ROOFFigure 56 - existing buildings **to be demolished**, FLAT ROOF, TIMBER JOISTS, DIAGONAL CRACK

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 29

Figure 57 - existing buildings to be demolished, perimeter wall INNER LEAF - CAVITY - OUTER LEAF



Figure 58 - INTERNAL SPINE WALL spans full height to valley gutter for the last TWO bays closest to SE elevation



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 30

Figure 59 - existing buildings VIEW OF BACK WALL to zone 3 to the remain



Figure 60 - existing buildings VIEW OF PLANT ROOM to remain



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 31

Figure 61 - DIAGONAL CRACK to zone 3 walls typically every 9m



Figure 62 - existing buildings to be demolished



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 32

Figure 63 - existing buildings to be demolished



Figure 64 - existing buildings to be demolished



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 33

Figure 65 - existing buildings to be demolished



Figure 66 - existing buildings to be demolished



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 34

Figure 67 - existing buildings to be demolished **to be demolished**Figure 68 - existing buildings **to be demolished**

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 35

Figure 69 - existing buildings to be demolished **to be demolished**Figure 70 - existing buildings **to be demolished**

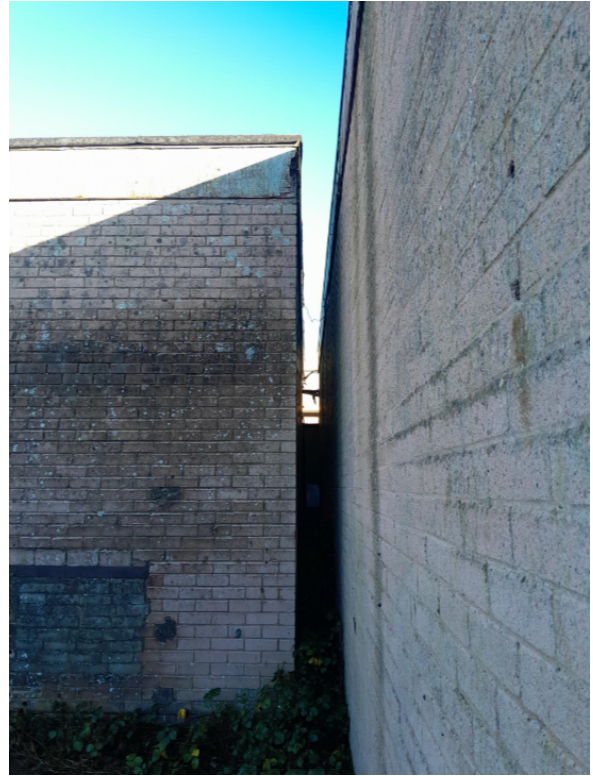
Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 36

Figure 71 - existing buildings to be demolished **to be demolished**Figure 72 - existing buildings **to be demolished**

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 37

Figure 73 - existing buildings to be demolished **to be demolished**Figure 74 - existing buildings **to be demolished**

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 38

Figure 75 - existing buildings to be demolished **to be demolished**Figure 76 - existing buildings **to be demolished**

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 39

Figure 77 - existing buildings to be demolished **to be demolished**Figure 78 - existing buildings **to be demolished**

Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		
	Job No: 085788	Made by: JTS Chkd by: PT	

Sheet No: 40

Figure 79 - existing buildings to be demolished



Figure 80 - existing buildings to be demolished



Curtins Consulting Ltd K Village, Riverside Place, Units 24-25, Lound Rd, Kendal LA9 7FH	Subject Cleator Moor Innovation Quarter Photograph Survey Log		Curtins
	Job No: 085788	Made by: JTS Chkd by: PT	
			Sheet No: 41

Figure 81 - existing buildings to be demolished



Figure 82 - existing buildings to be demolished

